

## Service Information Bulletin

### Subject:

Poor starting (when engine is cold); engine shuts off; poor engine response when clutch is engaged after selecting a gear.

### Models:

2005 model year F 650 CS, F 650 GS, F 650 Dakar.

### Aftersales Solution:

Important note: This upgrade is to be completed only in cases of a customer complaint. Upgrade the BMS-C2 module software program from 170 to 180. Program release 180 has been used in F 650 series production from June 4, 2004 (starting with the VINs below).

### Model-----Starting VIN

F 650 GS-----ZL 40815

F 650 GS Dakar----ZL 45268

F 650 CS-----ZM 50299

### Warranty Information:

This update is covered under the terms of the New Motorcycle Limited Warranty. Submit a regular warranty claim using the claim keys noted below:

--Defect Code: 13 61 53 79 00

--Description: BMS-wrong data version.

--Flat Rate Code: 13 99 000

--FRUs: 3 FRU

### Contact:

Respective Aftersales Business Consultant.